

Version 2.0.0.18

Release Date: Oct 26, 2010

Component Versions

1. LTE Emulators : 2.0.0.18
2. LTE Emulators Console: 2.0.0.18

Resolved Issues

Issue #	Summary
5028	Ordering of IEs in S1AP Initial UE Message should follow ASN.1 definition instead of the tabular format as specified in 36.413
5029	MME should interpret UE-AMBR value in bps received in ULA from HSS.
5030	UE PDN IPv4 address received in ULA from HSS is not included in Attach Accept message.
4991	Enhanced handling of "Sync Failure" in MME / HSS.
5031	UDP Source port for GTPv2C Triggered Message is not correct in a specific case.
5032	Create Session Response sent by PGW does not contain "PGW S5/S8 Address for Control Plane" IE in a specific case.
5033	GTP-U Header Decode issue when Sequence Number is not present in the header.

Known Issues

Issue #	Summary
4985	The MME Emulator may terminate abnormally when several hundreds of UEs attempt to execute an S10-based Handover without SGW Relocation.
4980	An S1-based Handover to a Target eNodeB fails if the Target eNodeB is created after the "UE Attach" and if the Target eNodeB serves a different TAC.
4979	S1 Reset does not always destroy the UE Context completely.
4821	If MME Emulator is restarted without restarting the Console, the Console does not allow existing UEs to attach using the new MME.
5034	S5-c tunnel count does not decrease in SGW after receiving Create Session Response with "request rejected" cause value.